MANUAL

LYNX

| Hardware Connection | **P1** |
| Packing List | **P3** |

Download latest **JMStudio** from
https://forum.jimumeta.com/home/help/download.html

Get latest **Manual** from
https://forum.jimumeta.com/home/help/manual.html

P1 HARDWARE CONNECTION

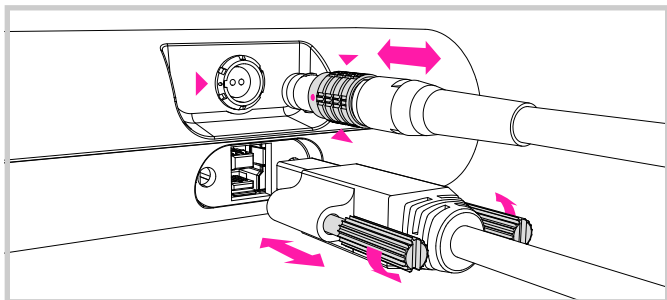**Turntable Cable***

USB Cable

Power Cable

Device Cable*

3DMAKERPRO
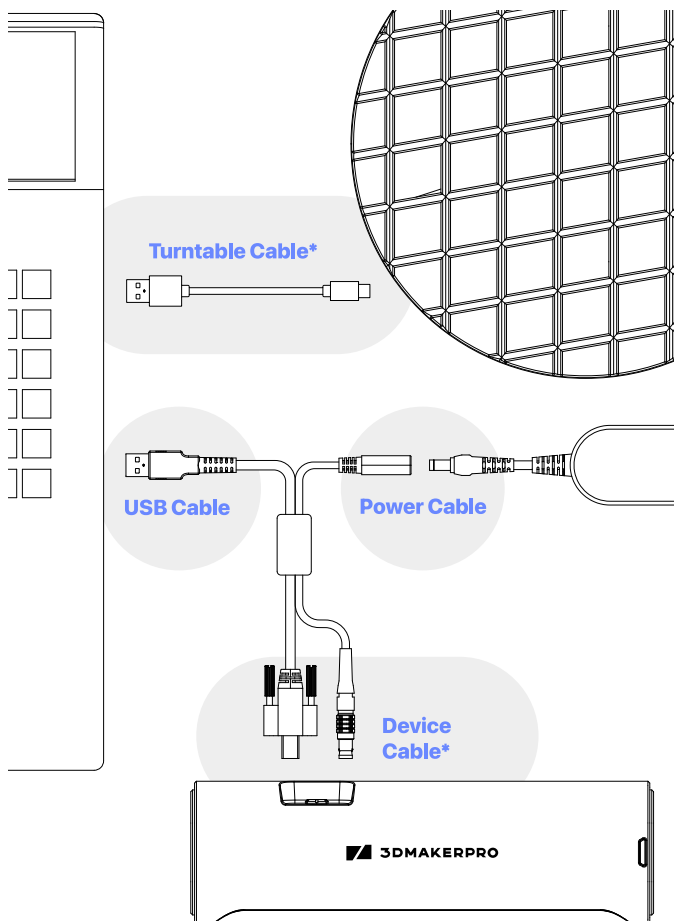
Plug one side of the data transmission cable (as it's showing Device Cable) into the scanner, another into the computer USB port and power adapter;

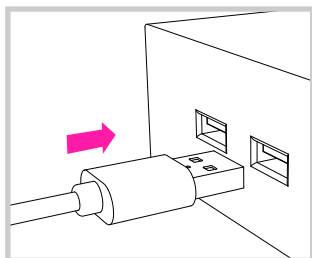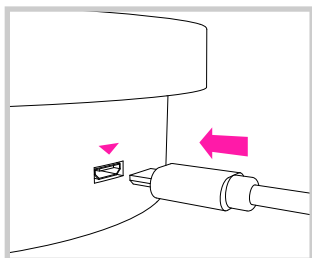The turntable cable is for powering up the turntable.

* Device Cable

Plug the device cable into the port of the scanner, make sure the red dot is lined up with the groove on the port；
To unplug the cable, move backwards the bushing (as marked with the red triangles) and pull out the cable directly.
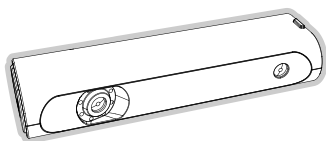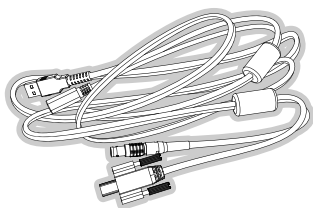
* Turntable Cable

The turntable can be powered up by connecting it to the computer or the power adapter with the turntable cable.
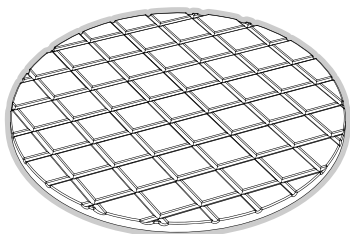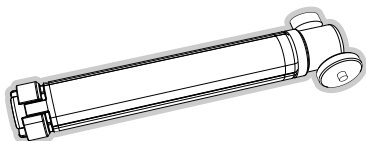
P3 PACKING LIST

Scanner Body

Device Cable

Turntable Surface[1]

Power Adapter

Tripod[2]

Turntable Cable[3]

Turntable[4]

Manual

* Product images are for illustrative purposes only.
* [1][2][3][4] Not included in the Standard Combo.

Operating System Requirement

Minimum	Intel Core i5 8th, 16GB RAM, MX250 GPU with 2GB VRAM
Recommended	Intel Core i7 8th, 16GB RAM, NVDIA1060 GPU with 4GB VRAM

⚠ **To prevent antivirus software from blocking the driver, please uninstall the antivirus software.**